# Recorders Tape-Deck RTS-13

Service
Service
Service

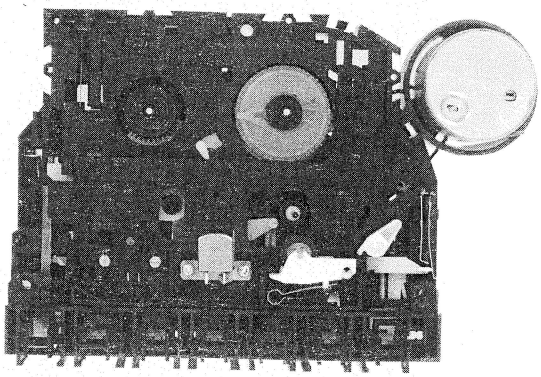

32 175A

# Service Manual

(GB)

The RTS-13 tape-deck is identical with the RTS-1 tape-deck, however with the following exceptions:

The bracket with item number 64 has been cancelled.
See Fig. 1; pos. 60 added.
The items 79, 505, 506 have been cancelled.
The codenumbers for K1, K2, M1 of the RTS-1 have also been cancelled.

(NL)

Het RTS-13 loopwerk is gelijk aan het RTS-1 loopwerk met de volgende uitzonderingen:

De beugel pos. 64 is vervallen.
Zie Fig. 1; pos. 60 toegevoegd.
De pos. 79, 505, 506 zijn vervallen.
De kodenummers voor K1, K2, M1 uit de RTS-1 zijn ook vervallen.

(F)

La mécanique RTS-13 est pareille à la RTS-1 à l'exception de ce qui suit:

L'étrier rep. 64 est supprimée.
Voir en Fig. 1; le rep. 60 a été ajouté.
Les rep. 79, 505, 506 sont supprimés.
Les codes K1, K2, M1 du RTS-1 sont aussi supprimés.

60 = 4822 276 11097
K1 = 4822 249 30075
K2 = 4822 249 40096
M1 = 4822 361 20486

(D)

Das RTS-13-Laufwerk ist dem RTS-1-Laufwerk gleich allerdings mit folgenden Ausnahmen:

Bügel Pos. 64 ist entfallen.
Siehe Fig. 1; Pos. 60 hinzugefügt.
Die Pos. 79, 505, 506 sind entfallen.
Die Codenummer für K1, K2, M1 vom RTS-1-Laufwerk sind ebenfalls entfallen.

(I)

Il meccanismo RTS-13 è uguale al RTS-1, eccetto:

La squadra pos. 64 è stata soppressa.
Vedi in Fig. 1; la pos. 60 è stata aggiunta.
La pos. 79, 505, 506 é soppressa.
I codici K1, K2, M1 del RTS-1 sono anche stati soppressi.

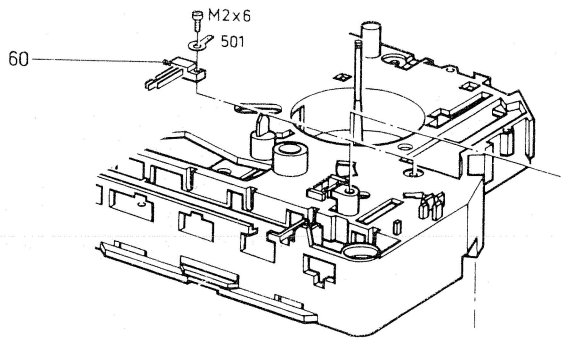


35 462 A12

Fig. 1

Documentation Technique Service Dokumentation Documentazione di Servizio Huolte-Ohje Manual de Servicio Manual de Servicio

Subject to modification

4822 725 20344

Printed in The Netherlands

Published by
Audio/Video Service

CS 96 865

"Pour votre sécurité, ces documents doivent être utilisés par des spécialistes agréés, seuls habilités à réparer votre appareil en panne".